

## **DEPARTMENT OF TRANSPORTATION**

### **Federal Aviation Administration**

#### **14 CFR Part 39**

**[Docket No. 2002-NM-259-AD; Amendment 39-13615; AD 2004-09-25]**

**RIN 2120-AA64**

#### **Airworthiness Directives; Saab Model SAAB 2000 Series Airplanes**

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule.

---

**SUMMARY:** This amendment adopts a new airworthiness directive (AD), applicable to certain Saab Model SAAB 2000 series airplanes, that requires an inspection of roll and pitch disconnect handles for spring forces outside limits, and adjustment of the spring force of the handles, if necessary. This action is necessary to prevent the roll and pitch disconnect handles from being difficult to operate, which could result in an increase in pilot workload and subsequent reduced controllability of the airplane. This action is intended to address the identified unsafe condition.

**DATES:** Effective June 15, 2004.

The incorporation by reference of a certain publication listed in the regulations is approved by the Director of the Federal Register as of June 15, 2004.

**ADDRESSES:** The service information referenced in this AD may be obtained from Saab Aircraft AB, SAAB Aircraft Product Support, S-581.88, Linköping, Sweden. This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to:

*[http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).*

**FOR FURTHER INFORMATION CONTACT:** Rosanne Ryburn, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2139; fax (425) 227-1149.

**SUPPLEMENTARY INFORMATION:** A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain

Saab Model SAAB 2000 series airplanes was published in the Federal Register on March 5, 2004 (69 FR 10370). That action proposed to require an inspection of roll and pitch disconnect handles for spring forces outside limits, and adjustment of the spring force of the handles, if necessary.

## **Comments**

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were submitted in response to the proposal or the FAA's determination of the cost to the public.

## **Conclusion**

The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

## **Cost Impact**

The FAA estimates that 3 airplanes of U.S. registry will be affected by this AD, that it will take approximately 4 work hours per airplane to accomplish the required inspection, and that the average labor rate is \$65 per work hour. Based on these figures, the cost impact of the AD on U.S. operators is estimated to be \$780, or \$260 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

## **Regulatory Impact**

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption ADDRESSES.

## **List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## **Adoption of the Amendment**

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

## **PART 39–AIRWORTHINESS DIRECTIVES**

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

### **§ 39.13 [Amended]**

2. Section 39.13 is amended by adding the following new airworthiness directive:

# AIRWORTHINESS DIRECTIVE

Aircraft Certification Service  
Washington, DC



U.S. Department  
of Transportation  
**Federal Aviation  
Administration**

*We post ADs on the internet at "www.faa.gov"*

The following Airworthiness Directive issued by the Federal Aviation Administration in accordance with the provisions of Title 14 of the Code of Federal Regulations (14 CFR) part 39, applies to an aircraft model of which our records indicate you may be the registered owner. Airworthiness Directives affect aviation safety and are regulations which require immediate attention. You are cautioned that no person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of the Airworthiness Directive (reference 14 CFR part 39, subpart 39.3).

**2004-09-25 Saab Aircraft AB:** Amendment 39-13615. Docket 2002-NM-259-AD.

**Applicability:** Model SAAB 2000 series airplanes, serial numbers -004 through -063 inclusive; certificated in any category.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent the roll and pitch disconnect handles from being difficult to operate, which could result in an increase in pilot workload and subsequent reduced controllability of the airplane, accomplish the following:

## Inspection and Modification

(a) Within 400 flight hours after the effective date of this AD, perform an inspection of the roll and pitch disconnect handles for difficult operation, in accordance with the Accomplishment Instructions of Saab Service Bulletin 2000-27-047, dated August 30, 2002. If the force required to move any disconnect handle is found to be outside the limits specified in the service bulletin, before further flight, adjust the spring force of the handle in accordance with the Accomplishment Instructions of the service bulletin.

## Parts Installation

(b) As of the effective date of this AD, no person may install on any airplane a roll disconnect handle, part number 7339056-503, or pitch disconnect handle, part number 7339056-504, unless it has been inspected and the spring force has been adjusted as applicable, per paragraph (a) of this AD.

## Alternative Methods of Compliance

(c) In accordance with 14 CFR 39.19, the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate, is authorized to approve alternative methods of compliance for this AD.

## Incorporation by Reference

(d) The actions shall be done in accordance with Saab Service Bulletin 2000-27-047, dated August 30, 2002. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Saab Aircraft AB, SAAB Aircraft Product Support, S-581.88, Linköping, Sweden. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington;

or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call (202) 741-6030, or go to:

*[http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html)*.

**Note 1:** The subject of this AD is addressed in Swedish airworthiness directive 1-177, dated August 30, 2002.

**Effective Date**

(e) This amendment becomes effective on June 15, 2004.

Issued in Renton, Washington, on April 28, 2004.

Kevin M. Mullin,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 04-10248 Filed 5-10-04; 8:45 am]

BILLING CODE 4910-13-P